





REPLACEMENT OF ELECTRONIC BOARDS ERF2021 WITH PART NO. 2425138xx

The electronic boards ERF2021 listed in Tab. A have been modified in the area of connector **J2** since the key **K** has been eliminated as indicated in Fig. 1.

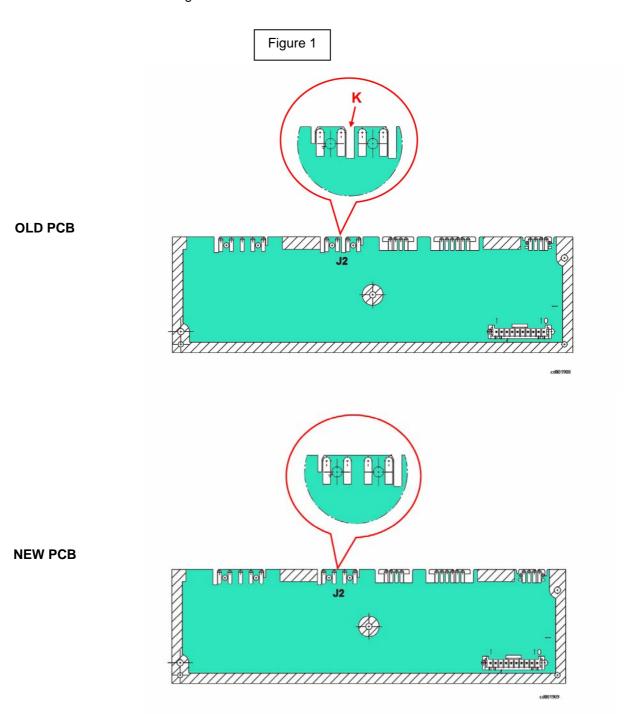


Publication no. **599 70 12-79** Service 07.08.08 ITZ/AA


Together with the modification to the electronic boards also the connectors of the electric wiring have been replaced. Therefore, in case of replacement of the old electronic boards with the new ones in the appliances with serial no. previous to 711xxxxxx, it is necessary to modify the connector **J2** as follows:

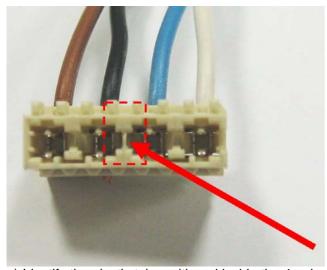


a) Identify the plastic tab positioned inside the 4-pole connector **J2** as indicated by the arrow in figure.

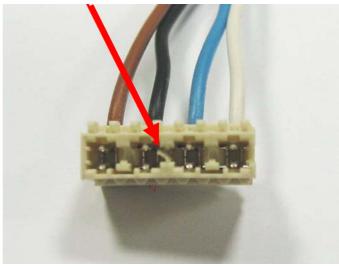

b) Using a cutter make a long cut along the upper part.

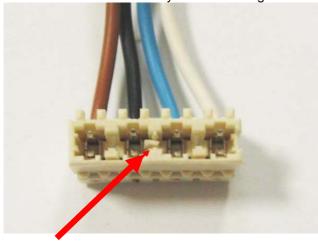

c) Make a long cut along the lower part.

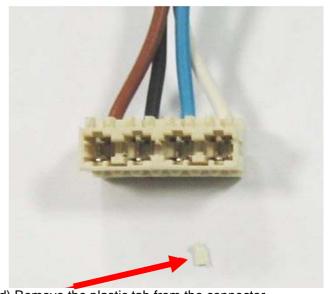

d) Remove the plastic tab from the connector.



ATTENTION: Be sure that the electric contacts are not damaged.

SPARE PART NOS.:

Tab. A

OLD ELECTRONIC BOARD PART NO.	NEW ELECTRONIC BOARD PART NO.
2425138076	2425138282
2425138100	2425138316
2425138118	2425138324
2425138142	2425138290
2425138159	2425138357
2425138233	2425138365